



## Elkhart County Parks Administration

211 West Lincoln Avenue


Goshen, Indiana 46526

Location		Structural Inconsistencies		Recommended Corrections/Modifications to Provide Access	Technical Information			Finalized Actions		
Location	Photo	Identified Issue	ADAAG Specification		Priority Ranking and Justification	Improvement Cost	Funding Source	Finalized Correction	Anticipated Date of Completion	Date of Completion
1. Parking	1	No "Van Accessible" sign at van accessible parking space. No enforcement procedure for accessible parking	4.6.4	ADAAG requires accessible parking spaces to be located in each parking lot. Accessible parking spaces are required to have upright signage that includes the symbol of a accessibility and van accessible signage where required. <b>Add one "Van Accessible" sign. Enforce parking regulations.</b>	<b>L</b> : Space is adequate for vans, just no sign posted.	\$50	Elkhart County General Fund	<b>Van accessible sign installed.</b>		<b>Jul-14</b>
2. Main work area	2	Aisles and pathways to materials and services do not meet the minimum required width. Aisles are 35 in wide.	4.2.1	ADAAG requires the minimum clear width for single wheel chair passage to be 32 in at a point and 36 in continuously. <b>Move desks and furniture to configure a wider space for accessibility.</b>	<b>H</b> : This can be completed with minimal effort and cost.	\$100	Elkhart County General Fund	<b>Reconfigured furniture</b>		<b>Jul-05</b>
3. Signage for goods and services, entire building	2	There are no signs in the building.	4.30	ADAAG requires signage to be mounted 60" from the floor, on the wall adjacent to latch side of door, to have raised characters and Braille text. <b>Signs are not necessary at this location. A staff member would guide the public during a visit to the office.</b>	This is not a requirement. No action is needed, but may be helpful.					
4. Rest Rooms	3	There is no signage provided for the rest room.	4.19.6	ADAAG requires mirrors to be mounted with the bottom edge of the reflecting surface no higher than 40" above finished floor. <b>In this case, this is the only rest room and it is accessible, so a sign is not required, but should be added.</b>	This is not a requirement. No action is needed, but may be helpful.					
5. Rest Rooms	4	Mirror is mount height exceeds the maximum requirement. The mirror is mounted at 44" from finished floor.	4.19.6	ADAAG requires mirrors to be mounted with the bottom edge of the reflecting surface no higher than 40" above finished floor. <b>Lower the mirror.</b>	<b>M</b> : This could be easily adjusted.	\$50	Elkhart County General Fund	<b>Mirror lowered.</b>		<b>Sep-14</b>





01. Parks Dept Parking Lot

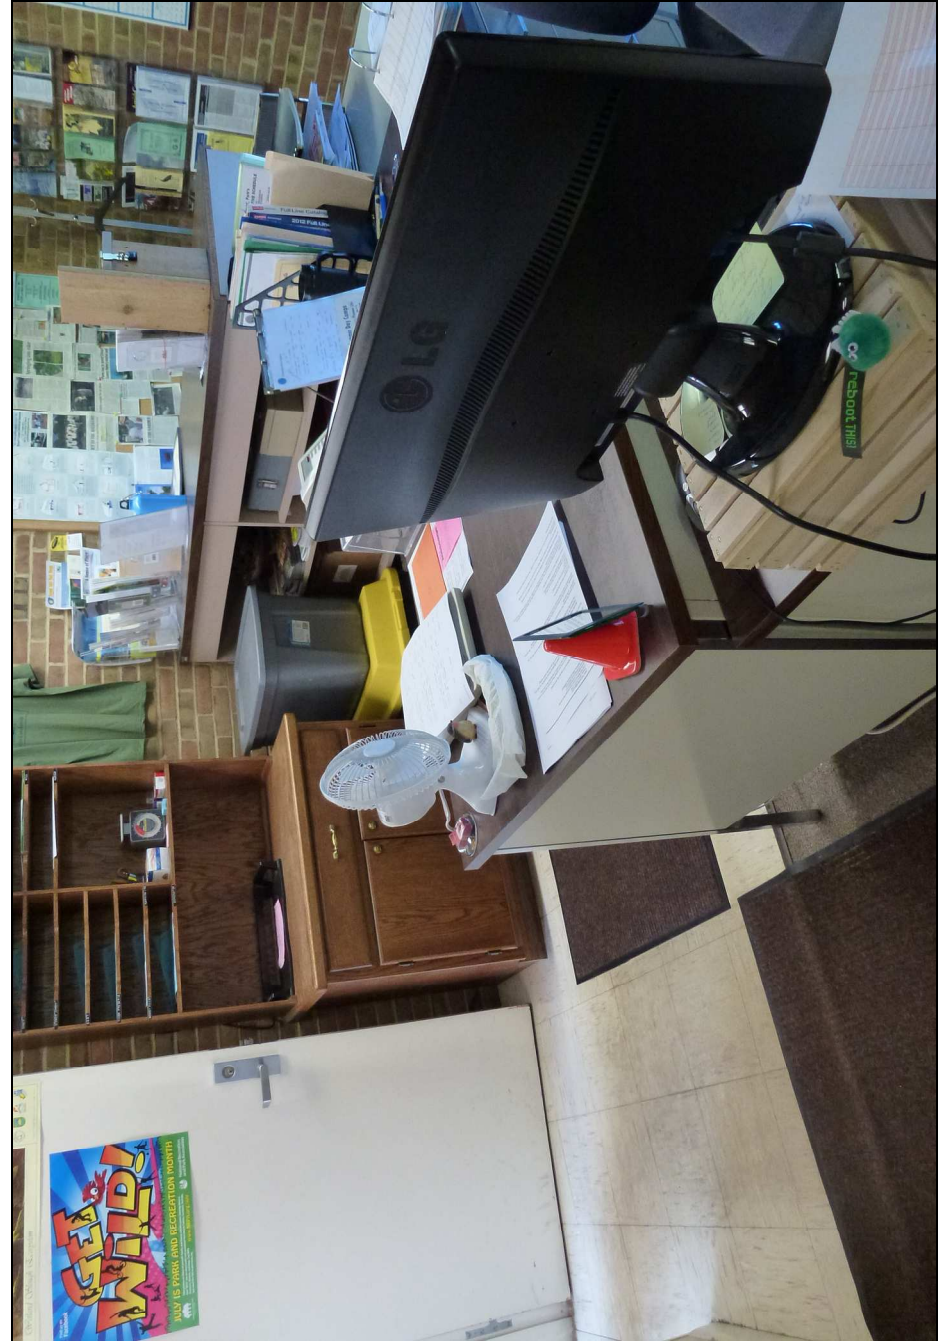


02. Parks Dept Service Counter





03. Parks Dept Rest Room

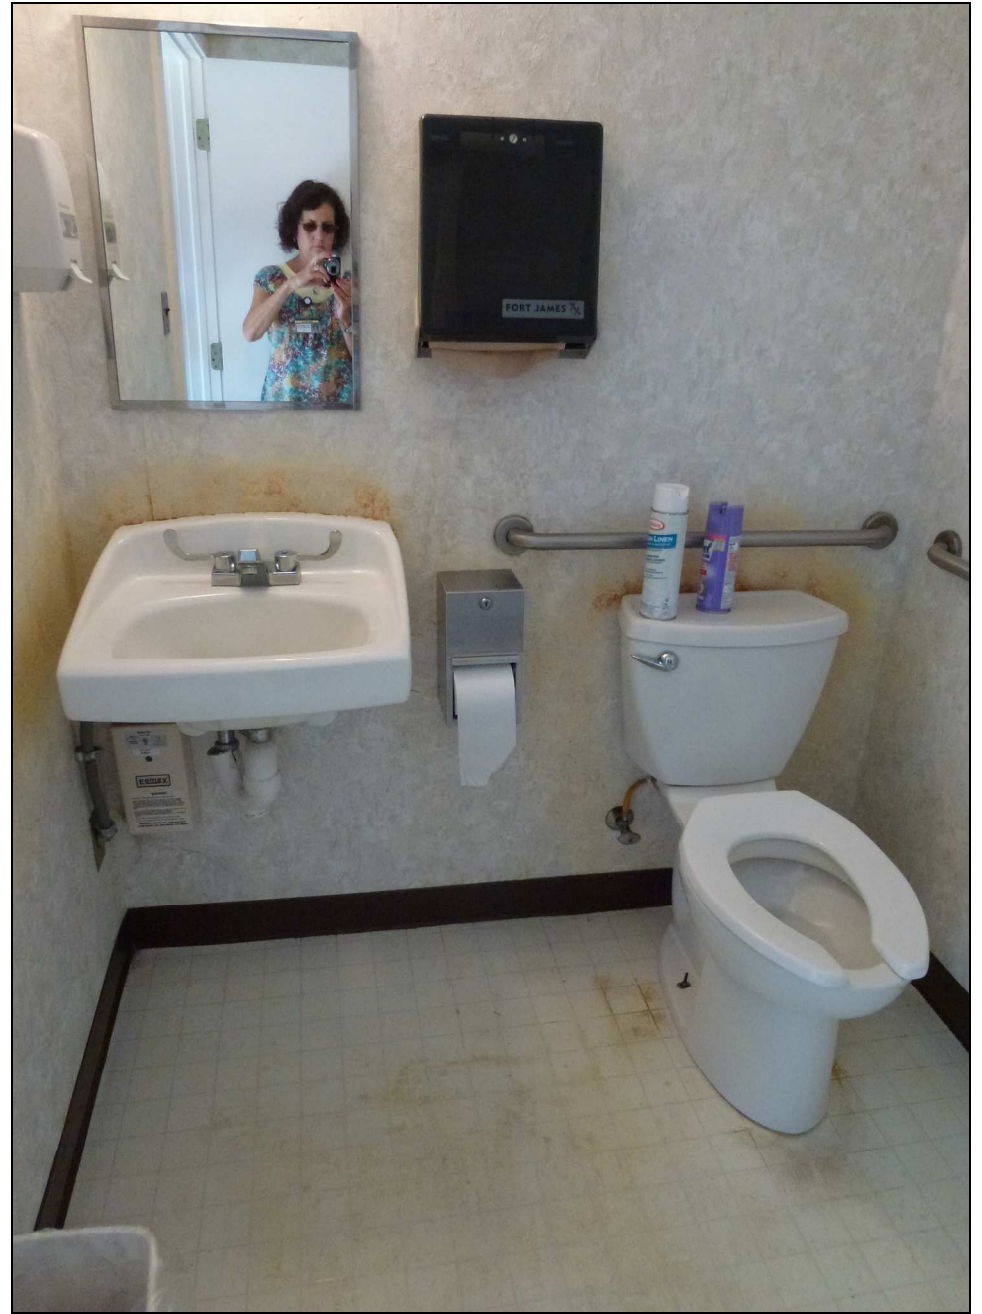

04. Parks Dept Rest Room (2)